




FMSC-205F-HYD-304

TOP AIR - 48809
FAST - 48834

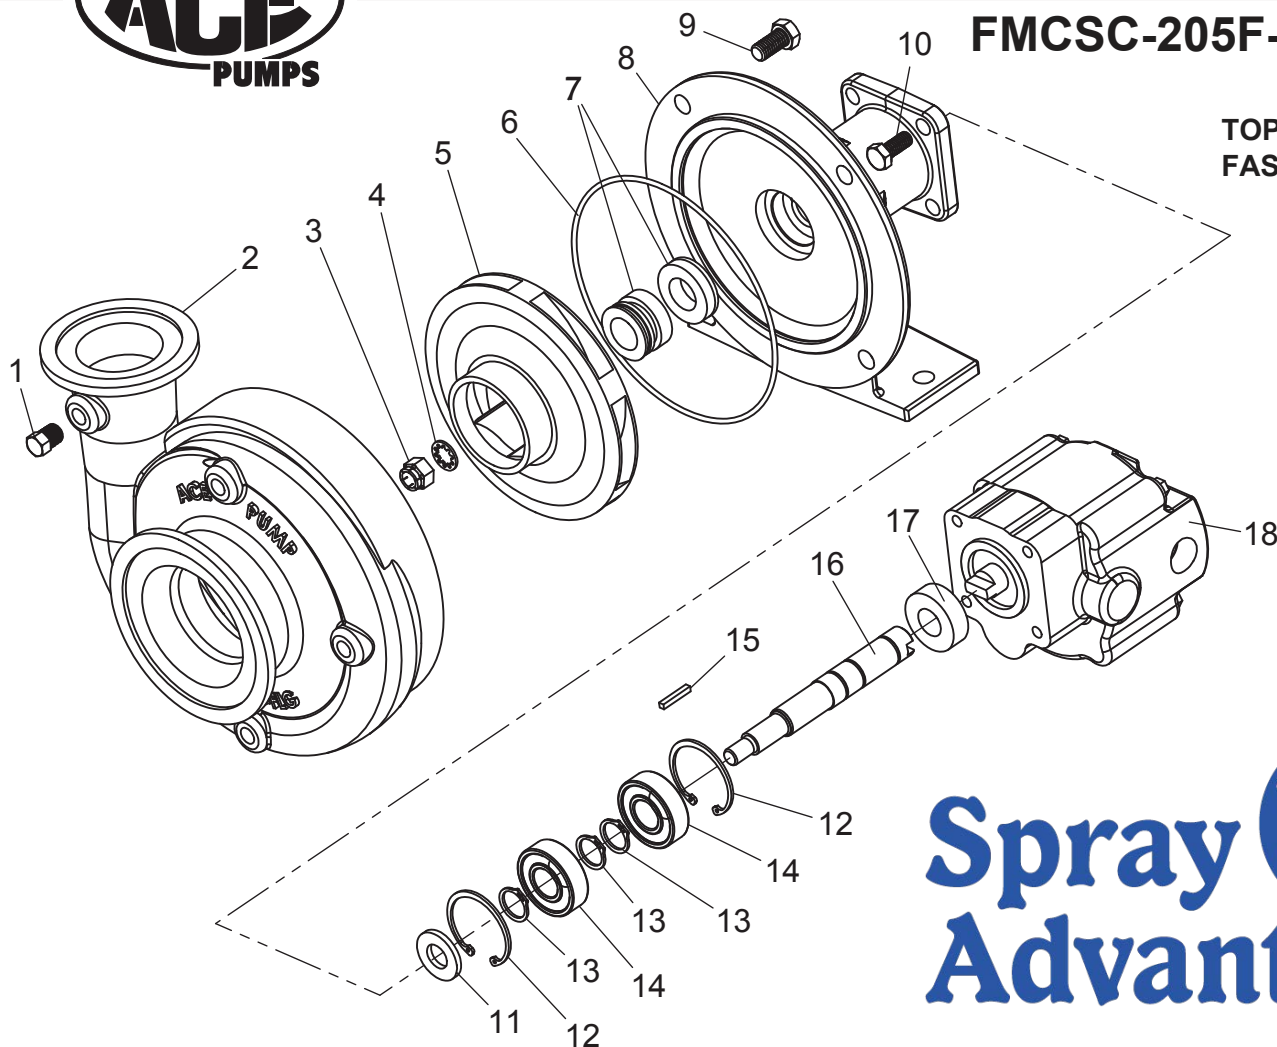

Spray Advantage

REF.#	PART NUMBER	EDP #	DESCRIPTION	REQ.
1	BAC-53	41110	Pipe plug	4
1	41120	41120	Pipe plug, stainless steel (optional)	4
2	7AC-14-FLG	41530	Volute, 300 standard flange x 220 full port flange	1
3	BAC-23-A	40391	Nut, 3/8" NF, cad plated	1
3	BAC-23-A-SS	40392	Nut, 3/8" NF, stainless steel (optional)	1
4	BAC-24-HYD-SS	40400	Washer, 3/8" star, stainless steel	1
5	BAC-26-200-P	40434	Impeller, with extended keyway, thermoplastic	1
5	BAC-26-200-CI	40433	Impeller, with extended keyway, cast iron (optional)	1
5	BAC-26-200-SS	40436	Impeller, with extended keyway, 316 stainless steel (optional)	1
6*	BAC-4A	40005	O-ring, body seal	1
7*	BAC-7SC-205V	40149	Seal, silicon carbide	1
8	BAC-14-205-HYD	40338	Mounting frame for 205 pump	1
9	40950	40950	Cap screw, 3/8" NC x 3/4" hex head	4
10	41330	41330	Cap screw, 5/16" NC x 3/4" hex head, motor to pump	4
11	BAC-54	41130	Slinger	1
12	BACH-33	40820	Snap ring, internal, BAC-14-205 mounting frame	2
13	BACH-32-HD	40835	Snap ring, external, BAC-6-205 shaft	
14	40880	40880	Ball bearing, sealed, BAC-6-205 shaft	2
15	BAC-25	40425	Key, 1/8" x 1/8" x 13/16", extended keyway	1
16	BAC-6-205-HYD-SS	40068	Shaft, extended keyway, tang, stainless steel	1
17	S305	40163	Seal support spacer for 205 series pump	1
18	BAC-75-HYD-304A	41388	Hydraulic motor, 13 GPM, 1/2" NPT ports	1
18	BAC-75-HYD-304A-12SAE	41426	Hydraulic motor, 13 GPM, #12 SAE end ports (optional)	1
*	RK-FMCS-205	52705	Repair kit for FM-205 pump with silicon carbide shaft seal	-
#	RK-BAC-75-HYD-300-L	41362	Repair kit for 300 Series hydraulic motor	-